



CDS G3 2020 v1 8/20/2020

Resolved Issues

- Fixed issue with VSL importing tool.

Known Issues

- Disconnecting the Power Steering Pump and connecting back to the boat from the Power Steering Pump screen may generate faults.

Workaround:

Return to the main G3 screen before disconnecting the pump and connecting to the boat.

- Starboard and Port DTS Command Modules may fail to reprogram on triple, quad or multi-helm vessels.

Workaround:

To prevent programming failures, key on only the module you want to reprogram. Once that module has been successfully reprogrammed, key that location off and move on to the next.

If a module failed to program previously, turn all keys off and remove battery power from the system.

Reapply battery power after 30 seconds and try again following the process above.

- All diagnostic tests will report hardware error once any test has failed for any reason.

Workaround:

Key off the affected engine, place the lever in RWOT, and key up to reset diagnostic tests.

- Clicking Reload Engines after keying off a conflicted engine does not work on several of the Diagnostic screens.

Workaround:

Exit and reopen the test with one of the engines keyed off.

- Several long standing "Known Issues" have been relocated to our support Web Site.

Workaround:

These can be accessed at service.mercurymarine.com

- Improved application security.